

Terminated with F/UTP cable	page 1-3
Terminated with S/FTP cable	
Terminated with U/FTP cable	

 
1. Termination Tool

110 termination tool set on low impact.



TERMINATED WITH F/UTP CABLE


- 2. Preparation and termination (F/UTP)
- 2a. Slide rear can and plastic cable clamp on to cable.
- 2b. 180° cable entry.



2c. 90° cable entry.



2d. Remove can cut-out for 90° cable entry.

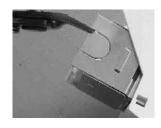


MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com


European Headquarters Tel: 44 (0) 1489 572111 www.molexpn.co.uk Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au



2e. Remove 100mm of cable sheath. Cut central separator back to sheath. Cut cellophane wrap back to sheath. Wrap foil around cable.

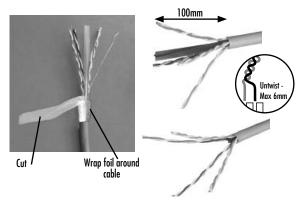

 
2f. Wrap drain wire around foil and tighten, leaving a length of drain wire available for wrapping around rear can cable clamp.







- 2g. Wiring Map.
- 2h. Terminate the jack before inserting it in front can.
- 2i. Ensure that the cable sheath is maintained up to the connector.
- 2j. Once terminated, the stuffer cap <u>must</u> be fitted to the connector.

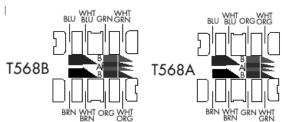



MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com

European Headquarters Tel: 44 (0) 1489 572111 www.molexpn.co.uk Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au

 


2k. Ensure cables are trimmed off flush with IDC, if not use side cutters to remove excess cable after termination.



3

Fitting Can and Securing Cable (F/UTP)
Slide the rear can over the front can. Ensure that the two halves are latched 3a. together securely.



Ensure that sufficient foil and drain wire makes contact with rear metal collar. 3b. Trim off excess foil.



Tighten the drain wire over the metal cable collar to maintain shield continuity. Зс.



Secure the cable with the plastic cable clamp, placed and tightened over the metal 3d. cable collar.





MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com

European Headquarters
Tel: 44 (0) 1489 572111 www.molexpn.co.uk

Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au

Molex Incorporated Tel: 630 969 4550 www.molex.com

3



TERMINATED WITH S/FTP CABLE

- 4. Preparation and termination (S/FTP)
- 4a. Slide plastic cable clamp and rear can on to cable.



4b Remove 100mm of cable sheath.




 
4c. Remove foil from pairs of cable. Twist braid and wrap around the cable sheath



4d. Wiring Map.



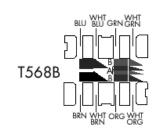



 Terminate cable ensuring that enough twisted braid is available to make contact when the rear can is fitted.



4f. Ensure cables are trimmed off flush with IDC, if not use side cutters to remove excess cable after termination.



MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com European Headquarters Tel: 44 (0) 1489 572111 www.molexpn.co.uk Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au

 


4g. Fit stuffer cap after termination.



5. Fiting Can and Securing Cable (S/FTP)

 Slide the rear can over the front can. Ensure that the two halves are latched together securely.



5b. Wrap braid around the metal cable collar to maintain shield continuity.





Secure the cable and braid with the plastic cable clamp, place and tighten over the metal cable collar.



 
MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com European Headquarters Tel: 44 (0) 1489 572111 www.molexpn.co.uk Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au



TERMINATED WITH U/FTP CABLE

- 6. Preparation and termination (U/FTP)
- 6a. Slide plastic cable clamp and rear can on to cable.




6b. Remove 100mm of cable sheath.



6c. Remove 3 of the 4 foils from the cable pairs. Unwrap the foil from 1 pair in preparation for wrapping around the cable sheath.

The dark side of foil is the <u>non-conductive</u> side. Ensure that this side faces the cable sheath when wrapped. The silver colour is the conductive side and must face outward.

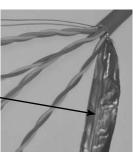

6d. Wrap the foil around the sheath with the conductive side of the foil facing outward.

Trim off excess foil.



MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com

European Headquarters Tel: 44 (0) 1489 572111 www.molexpn.co.uk Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au




 Wrap drain wire around foil and tighten, leaving a length of drain wire available for wrapping around rear can cable clamp.







6f. Wiring Map.

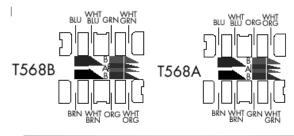

- $\mbox{ fg.} \qquad \mbox{ Terminate the jack before inserting it in front can.}$
- 6h. Ensure that the cable sheath is maintained up to the connector.
- 6i. Once terminated, the stuffer cap <u>must</u> be fitted to the connector.



 Ensure cables are trimmed off flush with IDC, if not use side cutters to remove excess cable after termination.



MOLEX PREMISE NETWORKS

Molex Premise Networks Corporate Headquarters Tel: 1 866 733 6659 www.molexpn.com European Headquarters Tel: 44 (0) 1489 572111 www.molexpn.co.uk Pac Rim Headquarters Tel: 61 3 9971 7111 www.molexpn.com.au



7 Fitting Can and Securing Cable (U/FTP)

 Slide the rear can over the front can. Ensure that the two halves are latched together securely.



Ensure that sufficient foil and drain wire makes contact with rear metal collar.
 Trim off excess foil.



7c. Tighten the drain wire over the metal cable collar to maintain shield continuity.



 Secure the cable with the plastic cable clamp, placed and tightened over the metal cable collar.



MOLEX PREMISE NETWORKS